UNIT SWITCH

Press the key of "UNIT", you can choose "g" or "oz".

OVER LOAD INDICATOR

When the scale is over loaded(3000g),

the "Err" will appear on the display.

ADVICE FOR USE AND CARE

- Keep the scale clean, Do not allow water to get inside the scale.

- Do not drop it or jump on the scale otherwise the scale is easy to be damaged.

- To ensure the life of the scale,do not put the scale under wet and hot condition.

- Do not use for legal trade.

CE

SensorDisc
EXCLUSIVE
TECHNOLOGY

LONGLIFE BATTERY

NEWLINE®

Electronic Kitchen Scale

For the purpose of proper using & maintaining the scale, please read this instruction completely before operating.

NEWLINE®

Electronic Kitchen Scale

For the purpose of proper using and maintaining the kitchen scale, please read this instruction completely before operating.

SPECIFICATIONS

- Equipped with a high precision strain gauge sensor system
- 4mm Tempered safety plate glass platform
- Capacity: 3000g
- Division: 1g
- LCD Display
- Tare function
- Low power / over-load indicator
- Time function
- Unit switch: g / oz
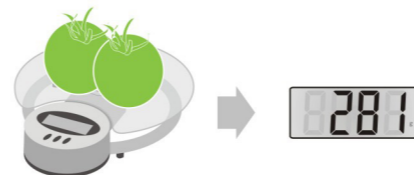- Electronic count down timer with bell function

POWER

- Powered by 1x3V CR2032 lithium battery (included)
- When low battery ,LCD indicates "Lo", please install the new battery after open the cover of the battery holder.

OPERATION

STEP1:Press the key of "ON/TARE", the scale will be zero after"HELO", appear on the display.and under the state of the weight.

STEP2:Put the object on the glass, the weight will appear on the display.

STEP3:After weighing, press the key of "MODE", the system return to time state

TARE FUNCTION

STEP1:Under the weighting state, put the container on the glass platform, LCD will show the weight of container.

STEP2: Press the key of "ON/TARE", LCD shows zero. To tare the weight of the container, then put the food into container, the weight of food will appear on the display, and repeat on.

TIME SETTING

The system is under the state of the time. Press " MODE "all the while to enter the mode of the setup.

Minute will twinkle on the display.

then press"UNIT" slightly, setup the minute.

Press "MODE" slightly again, minute will appear on the display.

Press " UNIT " slightly, setup the hour.

After finishing the setting. Press "MODE", then repristinate

COUNTDOWN TIMER SETTING

The system is under The state of the Countdown, Press " MODE "slightly, Enter the mode of the Countdown timer.

Press " MODE " all the while. The second will twinkle.

Press " UNIT ", setup the second.

Press " MODE " the minute will twinkle on the display.

Press " UNIT ", setup the minute.

After finishing the setup then press "MODE "to count the time.

After finishing the countdown "00:00" will appear on the LCD display,and send out the alarm signal.

Press "MODE" slightly to stop the alarm. Then press "MODE" change to the state of the time.

After finishing , No operation within 60 seconds. the system will enter the mode of the time.